



SERVICE BULLETIN

Date: 03.08.06

Model: '06 Elise/Exige a.c.

Number:

2006/20

CLASS 3

Service Manager	Service Reception	Supervisor	Parts Manager

TITLE: Momentary engine power interruption.

REASON: It has been found that on a very small number of '06 model year cars, with an unfavourable tolerance a.c. control module, it is possible under some circumstances that sparking across the a.c. compressor relay contacts can cause a voltage spike which results in the engine ECU resetting. This will be experienced as a momentary interruption of engine power, and is likely to occur only very occasionally. It is also possible that a throttle related trouble code may be set. e.g. P0638.

ACTION: If this symptom should be reported, it is recommended to replace the a.c./fan control module A117M0038F.